



**ZHONE
CPE Software Release Notes**

Date: **March 12, 2009**

Software Release Version File Number: 6218-I2-X0Y_03.02.04_312010G00

Software Release Notes Document Number: 6218 -I2-x0x_03.02.04_AnnexA_RN

Introduction: This document describes detailed release information containing firmware version, model numbers affected, new features (if added), improvements, defects corrected, known issues.

1. Product Information

Model Numbers affected by this Release: 6218-I2-x0x Annex A

2. Version and File Information

- a. Release Version File Name: 6218-I2-X0Y_03.02.04_312010G00
- b. Release File Name: 6218-I2-X0Y_03.02.04_312010G00_cfe_fs_kernel
- c. Firmware Version: 3-12-01-0G00.A2pB024k2.d20m.paraenwl69s
- d. DSL Driver Version: A2pB024k2.d20m
- e. USB Driver Version: NA
- f. WiFi Driver Version: 4.1.50.10.26.cpe1.2

4. Change Log – Current release

a. Updates and enhancements

- i. 3.00.28: Generate WEP Key by Passphrase.
- ii. 3.00.28: Show LAN MAC in Web's first page.
- iii. 3.00.28: Added DDNS services: DtDNS.com, NO-IP.com, Zoneedit.com.
- iv. 3.00.28: Added patch 17 of TR-069.
- v. 3.00.29: Added support for wlan CLI commands.
- vi. 3.00.31: New ADSL phy, A2pB022e.
- vii. 3.00.31: In Access Control List, added support for IP address mask entries.
- viii. 3.00.35: Use old ADSL phy and driver, A2pB019b10.d16m.(Special build)
- ix. 3.00.37: Use new ADSL phy, A2pB022g2.
- x. 3.00.37: Added support to edit the NATed IP address of WAN.
- xi. 3.00.37: Added support for Policy Route.
- xii. 3.00.37: Added CLI commands for supporting settings in Advanced Wireless page.
- xiii. 3.00.37: Allow editing of WAN Service Name.
- xiv. 3.00.37: Added 'admin' login for WAN side telnet or ftp.
- xv. 3.00.38: Add CLI command of SNMP.

Issued By		Reviewed By		Approved By	
Edward Law		Edward Law		Yong Lee	
Release Software	YES	Release Software	YES	Release Software	YES



Software Release Note for 6218-I2-x0x Release 03.02.04

- xxvi. 3.00.38: Add CLI command of RIP.
- xxvii. 3.00.38: Add CLI command of System Log.
- xxviii. 3.00.38: Change logo from "PARADYNE" to "ZHONE".
- xix. 3.00.38: Remove Policy Route support.
- xx. 3.00.38: Remove supporting to edit the NATed ip address of WAN.
- xxi. 3.00.39: Second IP address of LAN can be configure under Bridge mode.
- xxii. 3.00.40: New Zhone logo.
- xxiii. 3.00.41: Add CLI command : "policyrt".
- xxiv. 3.00.42: Add new option for "wan" CLI command : "--natpubip".
- xxv. 3.00.42: Change MTU setting from "iptables" to using PPPD LCP, so MTU maximum value of PPPOE on WEB GUI change to 1492.
- xxvi. 3.00.43: CLI command show policy protocol is different with GUI.
- xxvii. 3.00.43: New PPPoE frames filter option for PPPoE wan setting.
- xxviii. 3.00.43: Add MTU size setting for PPPoA wan setting.
- xxix. 3.00.43: Add description for how to setting ICMP services of wan side if no firewall enabled.
- xxx. 3.01.00: First release based on 3-10-02 code base.
- xxxi. 3.01.02: Change wireless default setting to disable.
- xxxii. 3.01.04: Added new CLI 'fdefault factory' to load factory default configuration.
- xxxiii. 3.01.07: Added PhyR supported DSL Phy firmware.
- xxxiv. 3.01.08: Added default NTP settings.
- xxxv. 3.02.00: first release based on 3-12.01 BRCM code.
- xxxvi. 3.02.00: UI checked with IE 6.0
- xxxvii. 3.02.00: UI checked with FireFox 3.0
- xxxviii. 3.02.00: UI checked with IE 7.0

b. Bugs Fixed:

- i. 3.00.28: Fixed DNS settings cannot be saved to flash.
- ii. 3.00.28: Fixed after using wizard to turn off wlan, wlan LED will turn on after unit is reboot.
- iii. 3.00.28: Fixed console showed "cat:/proc/net/ip_clear_dnscontrack: no such file or directory".
- iv. 3.00.28: Incomplete frame in Port Mapping page.
- v. 3.00.28: Fixed "There is no item to be removed" in Port Trigger page.
- vi. 3.00.28: Fixed Default Gateway configuration on PPP WAN setup page.
- vii. 3.00.28: Completed descriptions on "Add Dynamic DNS" info page.
- viii. 3.00.28: Fixed incorrect order on interface numbering in the LAN Statistic page.
- ix. 3.00.28: Added the "ADD" button in Port Trigger page.
- x. 3.00.28: Fixed incorrect port naming in Ethernet Mode page.
- xi. 3.00.28: Fixed Vlan didn't work when pinging the same remote server with WAN in Bridge mode.
- xii. 3.00.28: Fixed modem cannot be restored to default after Ethernet Mode had been modified.
- xiii. 3.00.31: Fixed the inability to create WAN PVC by CLI when ADSL status is not in 'Showtime' mode.
- xiv. 3.00.31: Fixed the lost of "fdefault save" configuration when modem's reset button was pressed twice for 15 seconds or more.
- xv. 3.00.31: Fixed. If SSID entry has 'space' key, it will be modified to empty after the

Issued By		Reviewed By		Approved By	
Edward Law		Edward Law		Yong Lee	
Release Software	YES	Release Software	YES	Release Software	YES



Software Release Note for 6218-I2-x0x Release 03.02.04
unit had been reboot.

- xvi.** 3.00.35: Fixed traffic failure when 802.1Q VLAN tag of WAN was enabled.
- xvii.** 3.00.35: Fixed IPsec add/edit page did not accept 1.1.1.0 when select subnet of remote/local IP address.
- xviii.** 3.00.35: Fixed maximum length of port entry in QoS setting to 11 so that a port range can be entered.
- xix.** 3.00.37: Fixed incorrect 54g rate in CLI.
- xx.** 3.00.37: Fixed configurations mismatch for GUI, CLI and Telnet.
- xxi.** 3.00.37: Fixed wrong spelling of WAN CLI command.
- xxii.** 3.00.37: Fixed different user level for Remote WAN Access.
- xxiii.** 3.00.43: Fixed default gateway will lost sometimes when using DHCP client with MER.
- xxiv.** 3.00.43: Fixed policy route CLI and GUI not sync and no need to reboot now.
- xxv.** 3.00.43: Fixed CPE will have two default gateways if change default gateway of CO side.
- xxvi.** 3.00.44: Fixed default gateway will lost sometimes when using DHCP client with MER.
- xxvii.** 3.00.44: Fixed MTU/multiple PVC issues: When add 1 MER and 1 PPPoE PVC, PPPoE PVC will prevent MER PVC packets with size 1460 from forwarding to LAN.
- xxviii.** 3.01.00: Fixed default configuration loss.
- xxix.** 3.01.00: Fixed system Log config 'log level' reset to default after reboot.
- xxx.** 3.01.01: Fixed unit cannot be reboot in sh mode when it became DHCP client.
- xxxi.** 3.01.01: Fixed HTTPD crashed caused by pressing the 'remove' and then 'edit' buttons quickly in the IPsec GUI page.
- xxxii.** 3.01.01: Fixed pre-shared key max length problem.
- xxxiii.** 3.01.01: Fixed QoS classification page Class ID option subnet mask setting.
- xxxiv.** 3.01.01: Fixed system crash after downgraded to previous old code base.
- xxxv.** 3.01.02: Fixed PPPoE/PPPoA MTU issues.
- xxxvi.** 3.01.02: Fixed tr60c – ACS redirect did not work.
- xxxvii.** 3.01.02: Fixed tr69c – Instance number issues.
- xxxviii.** 3.01.02: Fixed Policy route entry cannot be removed via GUI.
- xxxix.** 3.01.02: Fixed wrong Customer Name displayed in CLI.
 - xl.** 3.01.02: Fixed HTTPS crashed when the length of password entered is over 16.
 - xli.** 3.01.02: Fixed default interfaces of port mapping appeared as "nas_0_0_0".
 - xlvi.** 3.01.02: Fixed CLI command did not block invalid syslog server IP address.
 - xlvi.** 3.01.02: Fixed user was blocked by Parental Control rule even Internet Timer was disabled.
 - xlvii.** 3.01.02: Fixed DHCP client table did not display correctly.
 - xlviii.** 3.01.02: Fixed cannot execute 'reboot' via SSH.
 - xlix.** 3.01.02: Fixed Dynamic DNS page didn't refresh completely.
 - l.** 3.01.02: Fixed firmware upgrade via tftp remotely failed.
 - li.** 3.01.02: Fixed tr69c – allow wireless to apply current settings to CFM.
 - lii.** 3.01.04: Fixed reset to default didn't go back to Main page in Mozilla Firefox.
 - li.** 3.01.04: Fixed expired DHCP clients weren't removed from the DHCP info page.
 - lii.** 3.01.04: Fixed tr69c – Connection Request Authentication status was displayed incorrectly.
 - liii.** 3.01.04: Fixed tr69c – connectreq CLI showed wrong status.
 - liiii.** 3.01.04: Fixed do_page_fault occurred after 'policy delete' CLI was entered without rule name.

Issued By		Reviewed By		Approved By	
Edward Law		Edward Law		Yong Lee	
Release Software	YES	Release Software	YES	Release Software	YES



Software Release Note for 6218-I2-x0x Release 03.02.04

- iv. 3.01.04: Fixed "Test your Wireless Connection" showed Pass when wireless function has been disabled.
- iv. 3.01.05: Fixed tr69c – missing parameter: InternetGatewayDevice.WANDevice.1.WANConnectionDevice.2.WANPPPConnection.3.MACAddress.
- lvi. 3.01.07: Fixed tr69c – current time in Inform has an extra '0' at the end.
- lvii. 3.01.08: Fixed failure in sending Bootstrap when management server URL is set from the ACS.
- lviii. 3.02.00: Fixed TCP packet lost on 3-10-02 BRCM code.
- lix. 3.02.00: Fixed unable to upgrade FW or restore configuration with FireFox 3.0.
- lx. 3.02.00: Fixed the syslog level stayed in debugging when mode is remote.
- lxi. 3.02.01: Fixed UDP packets duplicated when two STB were connected via external switch on to one LAN port.
- lxii. 3.02.02: Fixed DSL Output Power values are different between GUI and CLI.
- lxiii. 3.02.02: Fixed unable to process ICMP unreachable for esp protocol issue.
- lxiv. 3.02.03: Fixed Virtual Server filed does not accept 'space' entry.
- lxv. 3.02.03: Fixed DHCP server always provide two DNS addresses even when one of them is speicified as "blank".
- lxvi. 3.02.03: Fixed Port Mapping configuration, "groupKey" & "groupStatus" in old code not compatible with new code.
- lxvii. 3.02.03: Import tr-069 fixes from 3-10-02 code to 3-12-01 code.
- lxviii. 3.02.04: Disallow IGMPv1/2 membership report to be forward between LAN ports.
- lxix. 3.02.04: Fixed SNMP MIB values reversed for "adslAtucCurrAttainableRate" and "adslAturCurrAttainableRate".

5. Limitations

- a. The PPP redirect function of close browser after submit is only testing with IE6 and FireFox1.5
- b. IP conntrack max table size is 2048
- c. ATM queue is 200

6. Known Issues

- a. Upgrading from 03.00.44 and previous to 03.02.04 may not preserve previous configuration settings and the unit may not function properly. A reset to factory default and configuration rebuild may be necessary.

Issued By		Reviewed By		Approved By	
Edward Law		Edward Law		Yong Lee	
Release Software	YES	Release Software	YES	Release Software	YES